

AD-781 053

**VERIFICATION OF RAINFALL ESTIMATES:
AN ANALYSIS OF ACTIVATION PATTERNS
OF ADSID AND ACOUSID SEISMIC AND
ACOUSTIC INTRUSION SENSORS TO DETERMINE
RAINFALL RATES**

Donald H. Kampwerth, et al

Air Weather Wing (6th)

Prepared for:

Air Weather Service

February 1974

DISTRIBUTED BY:

NTIS

**National Technical Information Service
U. S. DEPARTMENT OF COMMERCE
5285 Port Royal Road, Springfield Va. 22151**

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

REPORT DOCUMENTATION PAGE		READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER AWB-TR-74-253	2. GOVT ACCESSION NO.	3. RECIPIENT'S CATALOG NUMBER
4. TITLE (and Subtitle) VERIFICATION OF RAINFALL ESTIMATES: An Analysis of Activation Patterns of ADSID and ACOUSID Seismic and Acoustic Intrusion Sensors to Determine Rainfall Rates.		5. TYPE OF REPORT & PERIOD COVERED Final Report
7. AUTHOR(s) Lt Colonel Donald H. Kampwerth Captain Richard A. Rasmussen		6. PERFORMING ORG. REPORT NUMBER
9. PERFORMING ORGANIZATION NAME AND ADDRESS Detachment 10, 6th Weather Wing Eglin AFB, Florida 32542		8. CONTRACT OR GRANT NUMBER(s)
11. CONTROLLING OFFICE NAME AND ADDRESS Hq Air Weather Service (MAC) Scott AFB, Illinois 62225		10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS
14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office)		12. REPORT DATE February 1974
		13. NUMBER OF PAGES 57
		15. SECURITY CLASS. (of this report) Unclassified
		15a. DECLASSIFICATION/DOWNGRADING SCHEDULE
16. DISTRIBUTION STATEMENT (of this Report) Approved for Public Release; Distribution Unlimited		
17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report)		
18. SUPPLEMENTARY NOTES Sensor data collected by Armament Development and Test Center under Test Directive 0153A001, verification of Rainfall Estimates.		
19. KEY WORDS (Continue on reverse side if necessary and identify by block number) Rainfall rates Activation rates Seismic sensors Acoustic sensors ADSID ACOUSID <div style="text-align: center;">Reproduced by NATIONAL TECHNICAL INFORMATION SERVICE U S Department of Commerce Springfield VA 22151</div> Details of illustrations in this document may be better studied on microfiche		
20. ABSTRACT (Continue on reverse side if necessary and identify by block number) A test was conducted at Eglin AFB, Florida in the Fall of 1972 to verify rainfall rates as determined from the activation patterns of seismic and acoustic intru- sion sensors. Sensor activations were recorded, analyzed, and compared with rainfall rates as determined from recording rain gauges collocated with the sen- sor strings. Useful comparison data were obtained on nine tests, as definite sensor activation patterns were correlated with various rainfall rates. Scatter diagrams were prepared and analyzed to summarize the sensor activation/rainfall rate comparison.		

DD FORM 1 JAN 73 1473 EDITION OF 1 NOV-65 IS OBSOLETE

UNCLASSIFIED

Review and Approval Statement

This report approved for public release. There is no objection to the unlimited distribution of this report to the public at large, or by DDC to the National Technical Information Service (NTIS).

This technical report has been reviewed and is approved for publication.

James F. Shunk

JAMES F. SHUNK, Major, USAF
Asst Chief, Aerospace Requirements Division
Aerospace Services Directorate

FOR THE COMMANDER

Dale J. Flinders

DALE J. FLINDERS, Colonel, USAF
DCS/Aerospace Sciences

ACCESSION for	
NTIS	Write Section <input checked="" type="checkbox"/>
DDC	Buff Section <input type="checkbox"/>
UNCLASSIFIED	<input type="checkbox"/>
JUSTIFICATION.....	
BY.....	
DISTRIBUTION/AVAILABILITY CODES	
Dist.	AVAIL. and/or SPECIAL
A	

PREFACE

The authors express their appreciation to the following personnel for assistance in conducting the rainfall tests: Captains Kenneth Smidy and Edward Keppel, Det 10 Staff Meteorologists; TSgt Robert Booth and the entire maintenance section of Det 10; Mr Bill Relph and Mr James Pippin, ADTC/TGYN Project Engineers; and Maj James Shunk, Air Weather Service/DNT. During the reporting stage of the tests, Capt John Moore, Det 10 Staff Meteorologist, and Mr Dave Nichols, ADTC/TSGW, provided additional assistance.

DISTRIBUTION: F; Special

TABLE OF CONTENTS

	Page
INTRODUCTION	1
TEST EQUIPMENT AND LOCATIONS	1
Sensors.	1
Meteorological Equipment	2
CONDUCTING THE TESTS	5
COLLECTION OF RAW DATA	5
DATA ANALYSIS.	8
Rainfall Times	8
Initial Comparison	8
Rainfall Rates	9
Wind Data.	11
Sensor Data - Seismic Returns	11
Comparison of Rainfall and Seismic Sensor Data	11
Individual Comparison Results	17
Combined Comparison Results	28
Sensor Data - Acoustic Returns	28
CONCLUSIONS	35
RECOMMENDATIONS	36

LIST OF FIGURES

Fig 1. Location of four sensor strings with meteorological instruments.	3
Fig 2. Location of single sensor string with meteorological instruments (after 10 Nov 72).	4
Fig 3. Types of foliage in sensor areas and Blue Goose instrumentation van.	6
Fig 4. Meteorological instruments.	7
Fig 5. Example of Stevens recorder chart.	10
Fig 6. Example of X-T plot with operator's remarks.	12
Fig 7. Example of type 1 message printout.	13
Fig 8. Example of digital dump, giving time and content of all sensor signals.	14
Fig 9. Example of activations caused by vehicular traffic.	16
Fig 10. Individual gain 4 ADSID activation rate vs rainfall rate.	29
Fig 11. Average gain 4 ADSID activation rate vs rainfall rate.	29
Fig 12. Individual gain 4 ACOUSID seismic activation rate vs rainfall rate.	30
Fig 13. Average gain 4 ACOUSID seismic activation rate vs rainfall rate.	30
Fig 14. All gain 3 seismic activations vs rainfall rate.	31
Fig 15. Comparison of acoustic data received from two ACOUSIDs on 10 Nov 72.	32
Fig 16. Visual display of portion of acoustic data from 10 Nov 72.	34

VERIFICATION OF RAINFALL ESTIMATES

INTRODUCTION

During the 1971 and 1972 southwest monsoon seasons in Southeast Asia (SEA), the 1st Weather Group (1 WG) at Tan Son Nhut AB, Vietnam, made estimates of rainfall for the Ho Chi Minh Trail by analyzing the activation patterns from IGLOO WHITE seismic sensor strings. The data were collected at the Infiltration Surveillance Center and relayed to 7th Air Force (7 AF). These sensor-derived rainfall data soon became the primary source of rainfall knowledge for Laos because of the lack of other near real-time information. Rainfall estimates for the major pass areas and "choke-points" in the enemy's logistic network were of value to 7 AF in anticipating vehicular traffic levels.

The greatest limitation of the weather data secured from the sensors was the lack of verification of the rainfall estimates from independent sources. There was no question that the sensors activated for rainfall, and this fact allowed the tracking of rainshowers and thunderstorms across the sensor field and permitted the mapping of the spatial extent of rainfall areas. Even the relative change in a storm's intensity with time was detected by analyzing the sensor activation patterns. However, there was no way to verify the accuracy of the estimates of rainfall amounts. As the sensor weather data program was underway in a combat environment, a verification effort was impossible to undertake because of the lack of test equipment and available manpower, and the inaccessibility of the area of concern.

In a 9 December 1971 letter to 1st Weather Wing (1 WW), the 7 AF Staff Weather Officer Analysis Team (SWOAT) stated the need for a calibration test and recommended that the tests be performed at a CONUS location. The 1 WW endorsed the request in a forwarding letter to Air Weather Service (AWS), while HQ PACAF in a separate letter outlined the value of the rainfall data obtained from the sensors in SEA and recommended that calibration testing be performed at Eglin AFB, Florida. After HQ AWS contacted the Directorate of Sensor Matters (AFXOB) at HQ USAF, the Sensor Evaluation Group at Eglin, and Detachment 10, 6th Weather Wing at Eglin, it was determined that the tests were indeed feasible. HQ MAC provided the funds required for reimbursable test expenses, while Detachment 10 obtained four recording rain gauges from the US Geological Survey and AWS provided wind measuring sets. The Armament Development and Test Center (ADTC), Eglin AFB, provided the sensors, an instrumentation van to receive the sensor signals, computer reduction of the sensor data, and personnel to perform all functions necessary to collect the sensor data.

TEST EQUIPMENT AND LOCATIONS

Sensors

Description - The three types of sensors used in this test were the ADSID III, the ACOUSID III, and the COMMIKE III.

The ADSID III (Air-Delivered Seismic Intrusion Detector) is a purely seismic detector that was designed to detect ground vibrations created by moving vehicles or personnel. ADSID III is activated automatically whenever seismic disturbances exceed the sensitivity level of the sensor. The sensitivity level is a function of the gain setting of the geophone, and must be selected before the sensor is implanted.

The ACOUSID III (ACOUstic and Seismic Intrusion Detector) is a seismic sensor with a commandable acoustic interrogation capability. Thus, when the sensor is activated seismically by some disturbing element, a command can be sent to activate a microphone. The sensor will then transmit an audio record for 19 seconds. In this way, not only can the activations be confirmed, but some target discrimination can be performed. Interrogations of the sensor's status, as well as changes in gain setting, can be accomplished by radio command.

The COMMIKE III (COMmand microphone (MIKE)) is a passive, commandable acoustic sensor. This sensor is also air-delivered; however, a parachute is added to retard its fall speed as well as to aid emplacement in the upper foliage of trees. Because of its sensitive microphone and tree emplacement capability, this sensor is used to confirm the location of suspected enemy truck parks and staging areas and to monitor activities in those areas. The COMMIKE III relays acoustic information only upon command.

Emplacement - Thirty-six of these sensors from the IGLOO WHITE inventory were hand-emplaced in four strings in the west test area of Eglin AFB. Each sensor string consisted of alternately spaced ADSID III and ACOUSID III sensors, with one COMMIKE III sensor at the midpoint of the string. Sensors in each string were emplaced 100 meters apart and each parallel string was separated by approximately 1.0 kilometer (Figure 1). Data for the tests were collected at the "Blue Goose" instrumentation van, located at the west site. On 10 November 1972, the three strings of sensors east of the Blue Goose were removed as they were located in one of the deer hunting areas. For the remainder of the test, data were gathered from the west string only (Figure 2). The sensors were originally planted in the four strings to cover a large area and to detect rainfall in areas with different types of foliage. Pictures of the various foliage and the Blue Goose are shown in Figure 3.

Meteorological Equipment

Rain Gauges - Four recording rain gauges were obtained from the U.S. Geological Survey. Two were Stevens Recorders, Model #A35, and two were Water Level Recorders, Julien P. Friez and Sons, Co, Model #FA3. All four gauges used weight-driven chart paper drives. The rainfall was collected in a 12-inch diameter funnel which flowed into a 4-inch diameter holding tube. A float inside the tube was connected to a perforated steel tape which passed over a sprocket to a small counter-weight. As the water level in the tube rose, the float would rise causing the recording pen to move across the chart paper. The stands for the gauges were constructed by maintenance personnel of Det 10, 6 WW. Gear modifications

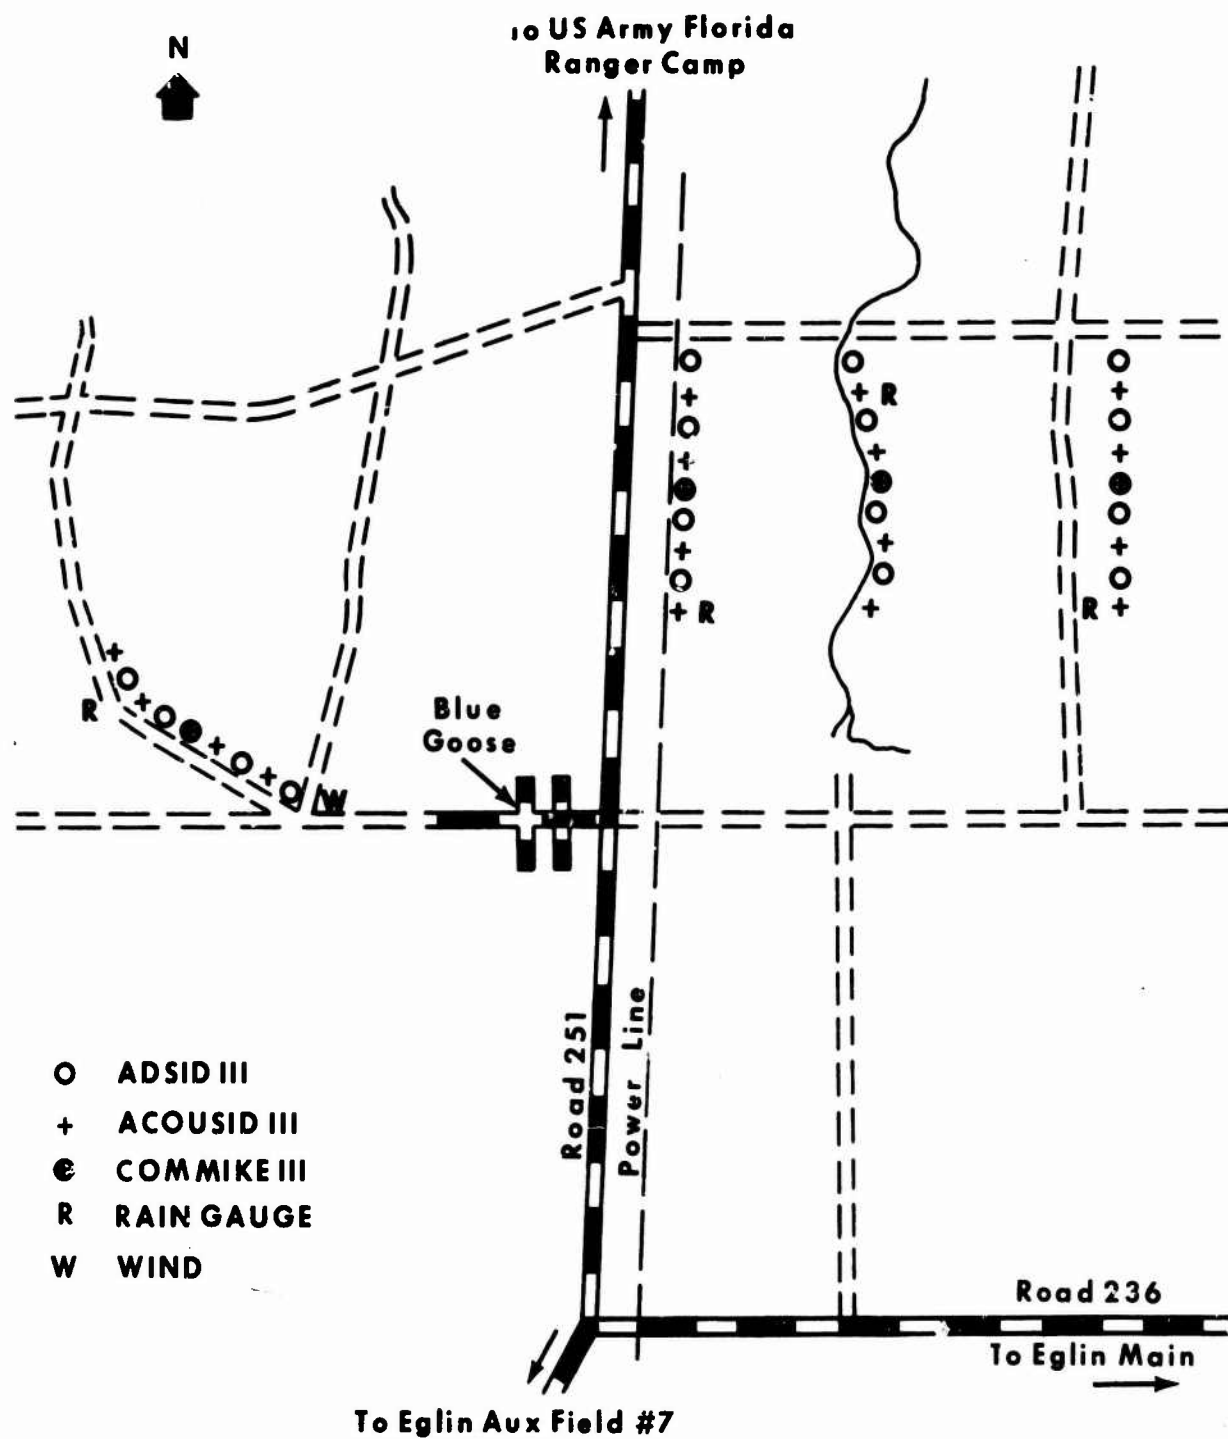


Fig 1. Location of four sensor strings with meteorological instruments.

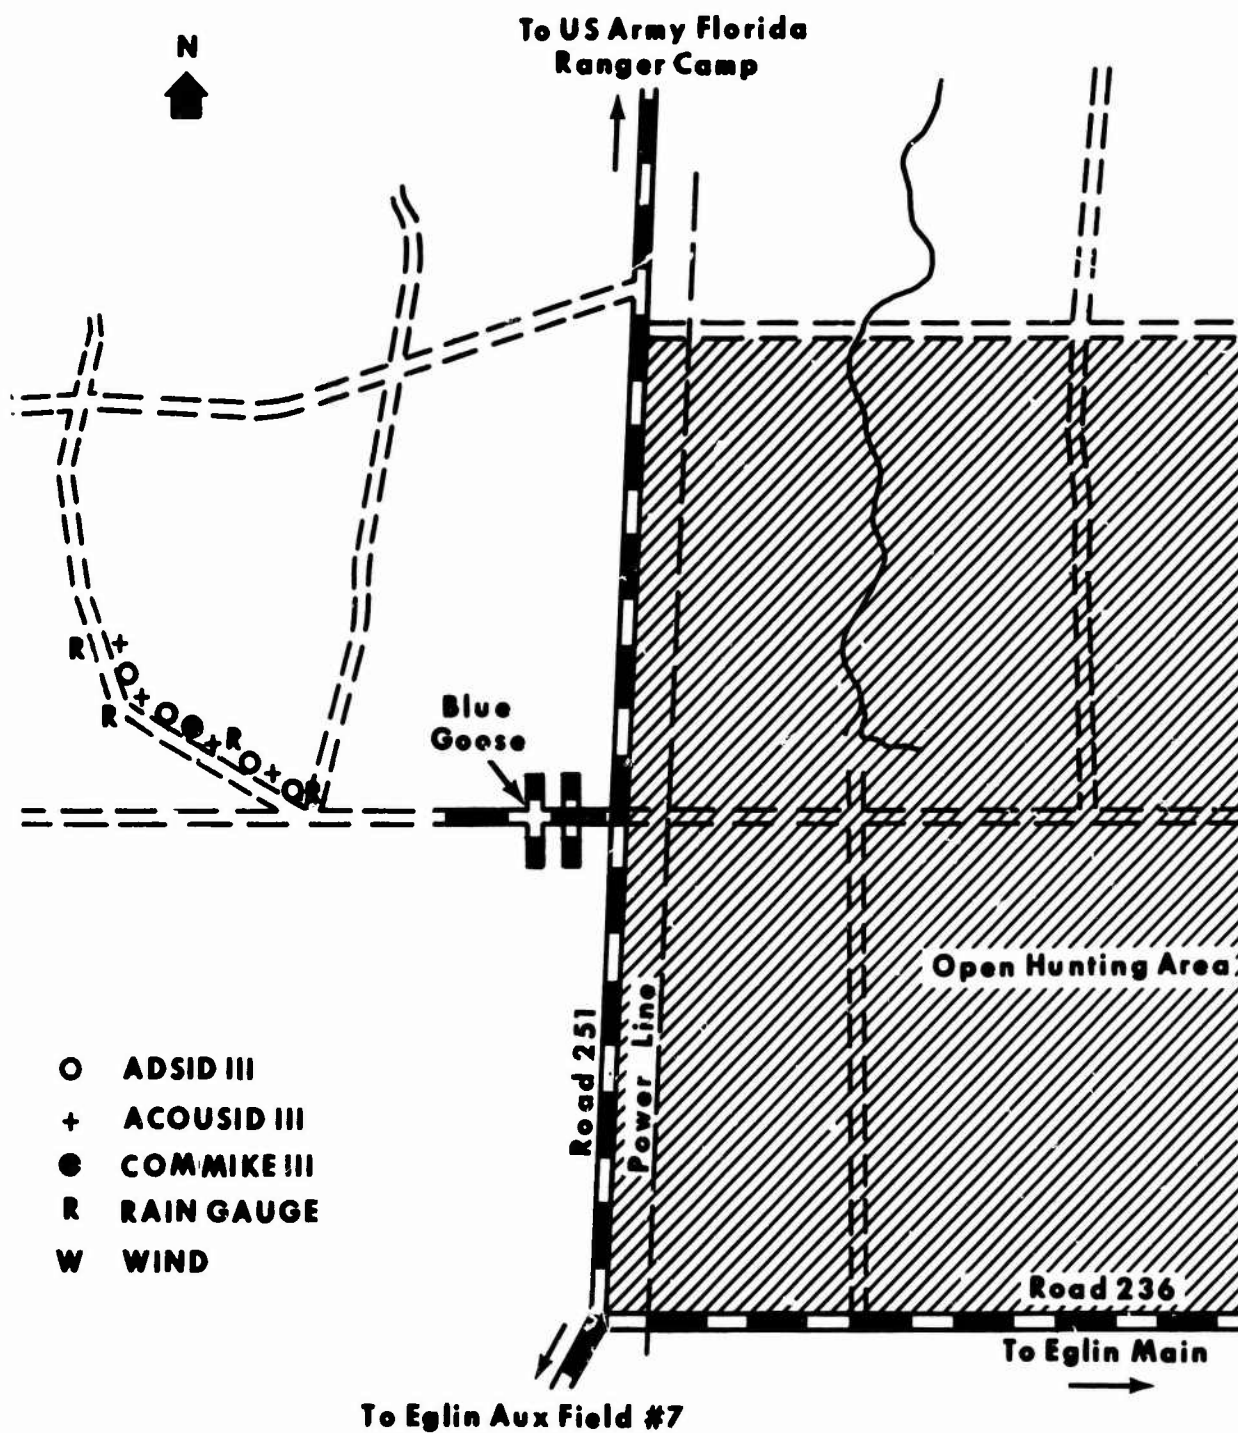


Fig 2. Location of single sensor string with meteorological instruments (after 10 Nov).

were made to increase the paper advance rate, and 4-inch holding tubes were constructed to replace the original 12-inch tubes. This expanded the time and rainfall scales for more accurate calculations of the rainfall rate. The rain gauges were originally placed at opposite ends of the sensor strings (Figure 1). On 10 November 1972, all four gauges were moved to the western sensor string (Figure 2) for the remainder of the test.

Wind Sets - A TMQ-15 Wind Measuring Set and Easterline Angus recorders were obtained from AWS resources. This was placed on the southern end of the western sensor string because that was the only location where 115-volt power for the recorder could be supplied. Pictures of the various gauges, their sites, and the TMQ-15 are shown in Figure 4.

CONDUCTING THE TESTS

Personnel from the Staff Meteorology Office, Det 10, 6 WW, were responsible for conducting the rainfall verification tests. When rainfall appeared imminent, they notified Wolfcall (the ADTC range test controller) who then coordinated the test times with the range contractor, whose personnel manned the "Blue Goose" instrumentation van. The Blue Goose had to be manned in order to collect any sensor data. Diesel-powered generators were used for power because of the high frequency of power outage in the area due to lightning strikes. Starting the generator and checkout of equipment required about a half hour before any data could be collected.

Several problems were encountered during this test. One problem concerned manning the Blue Goose after normal duty hours and on weekends. A long lead time forecast of rainshower activity over the sensor strings was not required during normal duty hours, since the contractor personnel were either working at the Blue Goose or at West Control, 3 miles away. However, most of the precipitation occurred during evenings and on weekends, so rainshower activity had to be forecast accurately with enough lead time to provide for manning of the Blue Goose. The AN/FPS-77 weather radar proved an invaluable tool in forecasting the shower activity. Another problem was the uncooperative weather during the early weeks of the test. During September, the precipitation was primarily in the form of light rainshowers, which moved rapidly with short average life times of 30 minutes. This was followed by more than 20 consecutive days in October with no precipitation. Finally, in November and December, there were several predictable squall lines which moved through the area and provided the basis for some useful data.

COLLECTION OF RAW DATA

The sensor data were collected at the Blue Goose in the following manner: The radio receivers fed the information to an instrumentation interface unit, which converted the signals into the proper format for the various recording instruments. All seismic activations and responses to commands were recorded on digital tape and an X-T (distance-time) plotter. Acoustic returns could be monitored real time with a speaker. All data received were recorded on an FR 1300 fourteen-track tape recorder



Fig 3. Types of foliage in sensor areas (upper left, east string; upper right, creek string; lower left, west string) and Blue Goose instrumentation van.



Fig 4. Meteorological instruments. Upper left, Friez water level recorder; upper right, Stevens recorder; lower left, complete rain collection device; lower right, TM2-15 wind set and recorder.

to facilitate recovery of any data required. All data were time-tagged, with accuracy measured in thousandths of seconds.

The rainfall data were acquired in a less sophisticated fashion. Every three days, or after a rainstorm of any intensity, staffmet personnel drove out to the test area. Due to the rough terrain and sand roads, a 4-wheel drive vehicle was required, and an average trip took three hours. If no rain had fallen, time checks were written on the rain gauge charts, and the clock weights re-wound. If some precipitation had been recorded, the charts were removed, the collecting tubes emptied, and the recorders reset. Time checks were entered on the strip charts before they were removed and when the recorders were restarted. The amount of rainfall was also measured in the collecting tubes and entered on the charts as a cross check. The recorders and tables were covered with plastic material to insure that no spurious rainfall ran into the collecting tubes.

The TMQ-15 wind recorder ran continuously, and the data were removed only when the strip chart needed replacement.

DATA ANALYSIS

Rainfall Times

In order to compute rainfall rates, it was necessary to determine the rate of chart advance in the recorders. The gear ratio selected should have driven the chart one small division per 15 minutes. However, we discovered considerable variation from machine to machine and even from time to time. Therefore, it was necessary to calculate chart speed on each record by dividing total elapsed time by the number of divisions covered. If a recorder stopped, the chart speed could not be determined definitely. Normally, the rate from the previous record was used in these cases. After chart rate was established, the times of onset and cessation of rain were determined.

Initial Comparison

The initial comparison between the sensor and rainfall data was to see if the sensors had been monitored while it was raining and had collected any usable data. Table 1 is a summary of that comparison:

February 1974

Technical Report 74-253

<u>Date</u>	<u>Mission Number</u>	<u>Times of Sensor Data</u>	<u>Times of Rainfall. data</u>	<u>Wind Data</u>	<u>Further Analysis</u>
21 Sep	4708	2133Z-2235Z	2200Z	---	No
22 Sep	5704	1835Z-2030Z	1920Z	---	No
25 Sep	1704	1929Z-2230Z	1930Z-2135Z	---	Yes
26 Sep	2707	1000Z-1648Z	None	---	No
23 Oct	1703	1526Z-1940Z	1526Z-1840Z	Yes	Yes
26 Oct	4706	2338Z-0431Z	2300Z-0330Z	---	Yes
27 Oct	5705	1211Z-1906Z	0500Z-1240Z	Yes	Yes
7 Nov	2706	2001Z-2155Z	2015Z-2035Z	---	Yes
10 Nov	5705	2109Z-2345Z	2115Z-2345Z	---	Yes
13 Nov	1703	1804Z-0138Z	1900Z-0138Z	---	Yes
25 Nov	6702	1408Z-1550Z	1408Z-1550Z	---	Yes
4 Dec	1704	1909Z-2231Z	1909Z-2215Z	---	Yes
5 Dec	2705	2118Z-2400Z	2130Z-2400Z	Yes	Yes
6 Dec	3707	1626Z-2201Z	1626Z-2103Z	---	Yes

Table 1. Summary of Sensor vs Rainfall Data for Further Analysis

Of the fourteen tests attempted, eleven warranted further evaluation. The three that were disregarded had no measurable rain, and the sensor returns were almost nonexistent.

Rainfall Rates

The next step was to compute the rainfall rates. This was done by noting the times when the rainfall rates changed (when the slope of the trace changed), calculating the time intervals, and measuring the horizontal distances the pen traveled within the intervals. (Figure 5 is an example of the record from the Stevens recorders.) The rates were then converted to inches per hour. After examining the variety of calculated rainfall rates, the following classifications were established for the purpose of discussion: light rain, less than 0.25 inches/hour; moderate rain, 0.25 to 1.0 inches/hour; and heavy rain, more than 1.0 inch/hour.

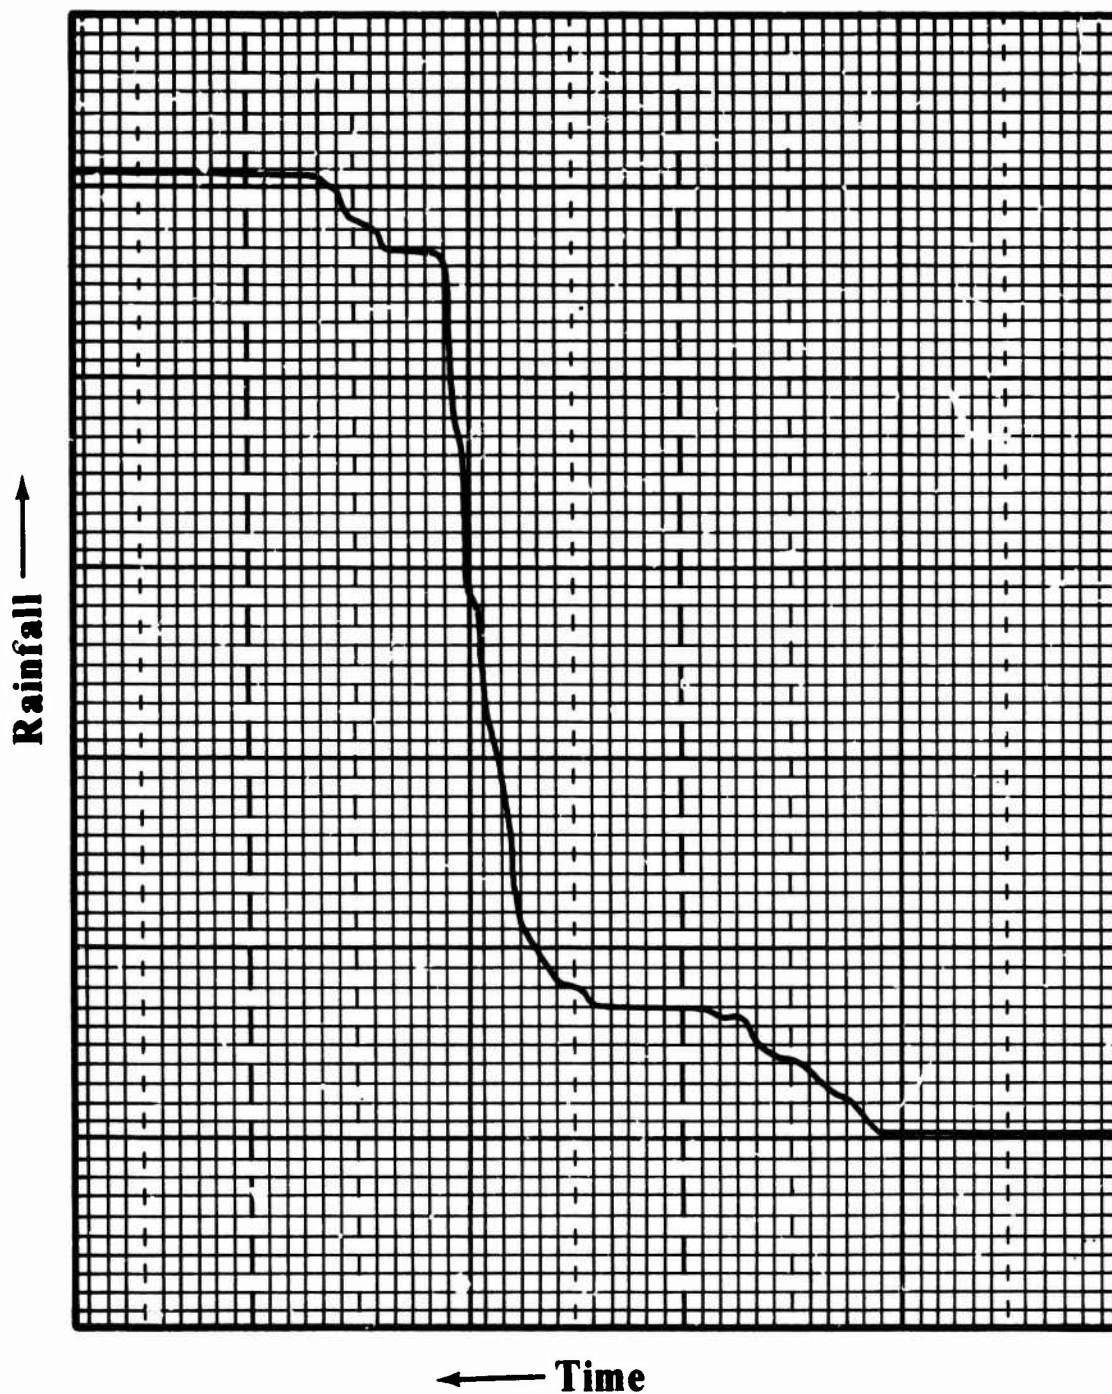


Fig 5. Example of Stevens recorder chart. One small time division equals 15 minutes, 7.5 small rainfall divisions equals 0.1 inch.

It became obvious at this time that the collection of accurate rainfall data would not be an easy task. Many problems were encountered such as clocks stopping, paper jamming, pen drive tapes slipping on the sprockets, pens not working, weights being stolen, and foreign material in the collecting funnel. Once the data were plotted, some timing errors were observed that could not be easily resolved. For example, a well defined line of thunderstorms moved through the test area over all four rain gauges. The rainfall data should have shown temporal continuity. However, ten to thirty minute variations were observed. Therefore, the timing of the rainfall turned out to be fairly subjective.

Wind Data

Wind data were only available on three tests. The TM-15 was not received prior to starting the test. Several days of data were missed due to paper jams in the recorder. Timing, however, seemed quite precise. Location of the wind set was a problem because we wanted it collocated with a sensor string; however, all of the sensors were in areas of tall pine trees. We selected a site with as much exposure as we could find, but the 10-foot mast placed the anemometer only above the smallest shrubs. Wind direction was not observed, because it would not relate to wind-caused seismic movement. Observed speeds were much below those observed at Eglin main base in storm situations. Available wind records were examined to determine whether winds caused seismic returns, especially when seismic returns could not be associated with rainfall.

Sensor Data - Seismic Returns

The seismic data obtained from the ADSIDs and ACOUSIDs were available in four formats. First, the X-T plot indicated each sensor activation, including the response to command of the ACOUSIDs (Figure 6). The operators also hand-scribed comments about weather at the Blue Goose site, as well as start and stop times of the audio commands. The other three formats were printouts from the CDC 6600 computer. One format (type 1 message) was one-minute summaries of the seismic activations from each sensor (Figure 7). Another format (all message types) was a similar minute-by-minute summary, but included the responses to command signals from the Blue Goose. The last format was a listing of all the signals recorded, with time to the millisecond (Figure 8).

Comparison of Rainfall and Seismic Sensor Data

Once all the rainfall had been analyzed and the data printouts obtained, the major task of comparing the rainfall rates to the seismic activations began. The eleven tests that appeared promising were individually analyzed. Three facts became obvious immediately: sensors activated for weather other than rain; the maximum activation rate was higher than the expected six times per minute; and sensors with identical gain settings could still have different sensitivity.

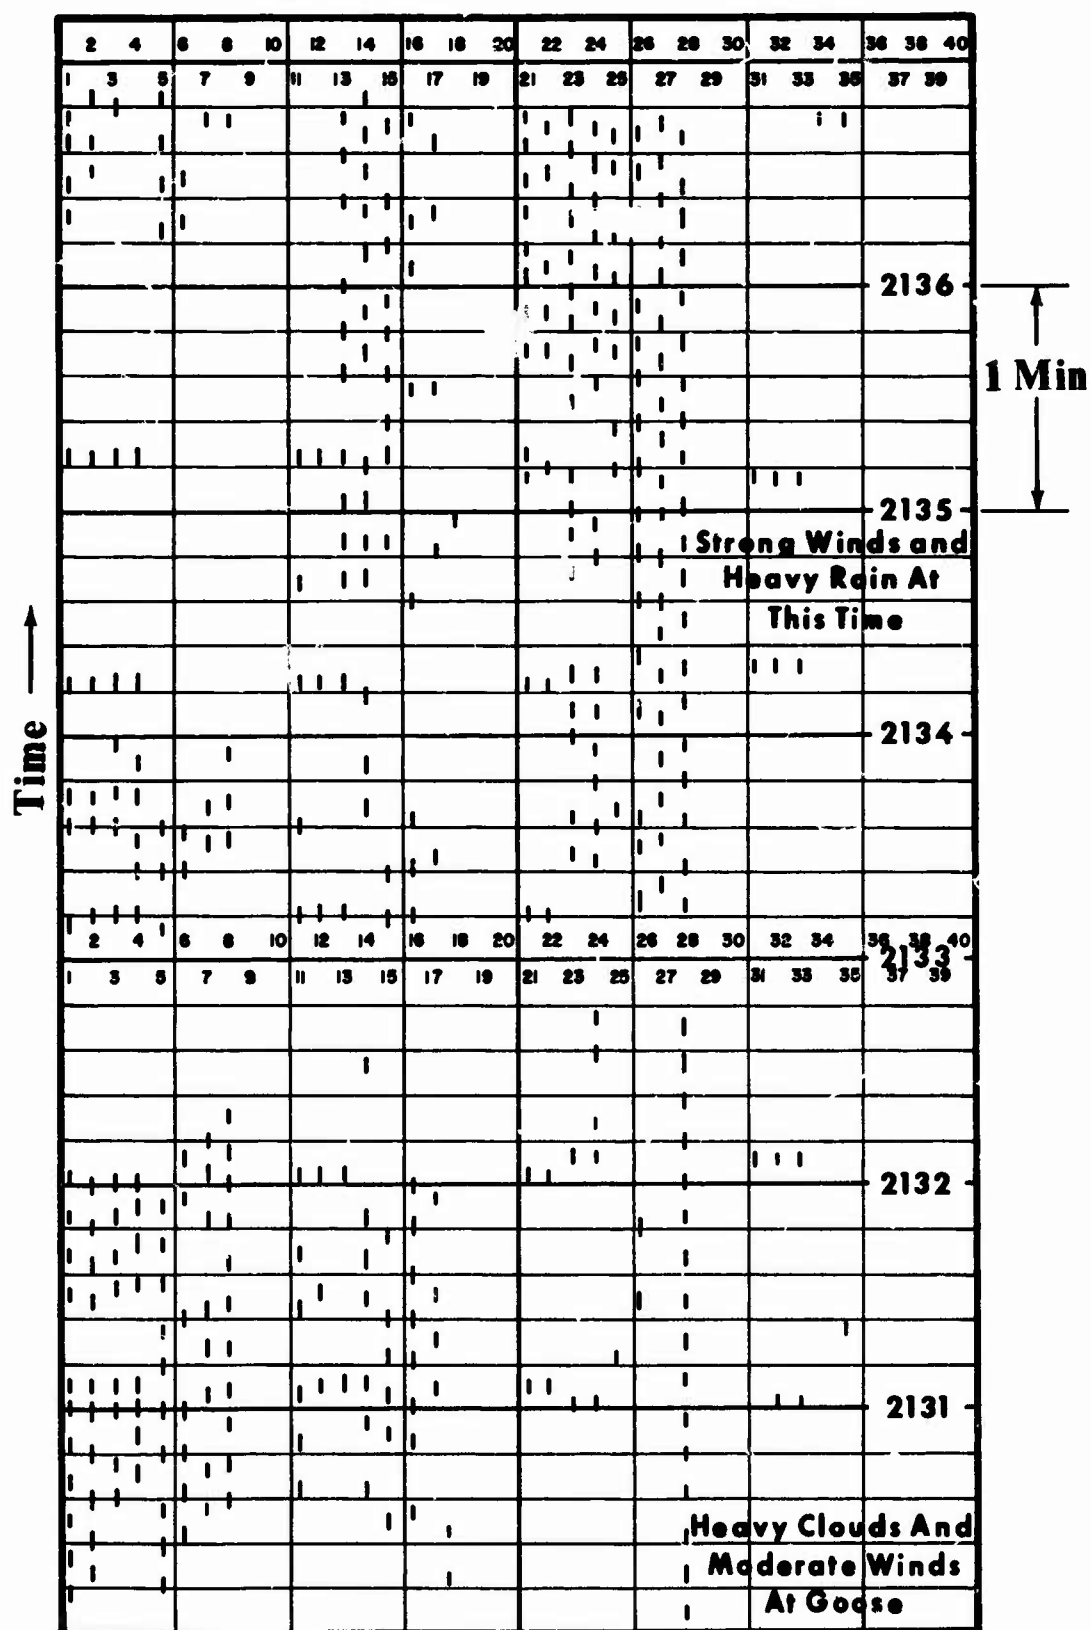


Fig 6. Example of X-T plot with operators' remarks.

PROJECT 0154N01 25 SEPT 72 NSN 1704 TYPE 1 MESSAGES									
TIME	ONE	MINUTE	INTERVALS	ONE	MINUTE	INTERVALS	ONE	MINUTE	INTERVALS
192900	1	1	1	1	1	1	1	1	1
193000	1	1	1	1	1	1	1	1	1
193100	1	1	1	1	1	1	1	1	1
193200	1	1	1	1	1	1	1	1	1
193300	1	1	1	1	1	1	1	1	1
193400	1	1	1	1	1	1	1	1	1
193500	1	1	1	1	1	1	1	1	1
193600	1	1	1	1	1	1	1	1	1
193700	1	1	1	1	1	1	1	1	1
193800	1	1	1	1	1	1	1	1	1
193900	1	1	1	1	1	1	1	1	1
194000	1	1	1	1	1	1	1	1	1
194100	1	1	1	1	1	1	1	1	1
194200	1	1	1	1	1	1	1	1	1
194300	1	1	1	1	1	1	1	1	1
194400	1	1	1	1	1	1	1	1	1
194500	1	1	1	1	1	1	1	1	1
194600	1	1	1	1	1	1	1	1	1
194700	1	1	1	1	1	1	1	1	1
194800	1	1	1	1	1	1	1	1	1
194900	1	1	1	1	1	1	1	1	1
195000	1	1	1	1	1	1	1	1	1
195100	1	1	1	1	1	1	1	1	1
195200	1	1	1	1	1	1	1	1	1
195300	1	1	1	1	1	1	1	1	1
195400	1	1	1	1	1	1	1	1	1
195500	1	1	1	1	1	1	1	1	1
195600	1	1	1	1	1	1	1	1	1
195700	1	1	1	1	1	1	1	1	1
195800	1	1	1	1	1	1	1	1	1
195900	1	1	1	1	1	1	1	1	1
200000	1	1	1	1	1	1	1	1	1
200100	1	1	1	1	1	1	1	1	1
200200	1	1	1	1	1	1	1	1	1
200300	1	1	1	1	1	1	1	1	1
200400	1	1	1	1	1	1	1	1	1
200500	1	1	1	1	1	1	1	1	1
200600	1	1	1	1	1	1	1	1	1
200700	1	1	1	1	1	1	1	1	1
200800	1	1	1	1	1	1	1	1	1
200900	1	1	1	1	1	1	1	1	1
201000	1	1	1	1	1	1	1	1	1
201100	1	1	1	1	1	1	1	1	1
201200	1	1	1	1	1	1	1	1	1
201300	1	1	1	1	1	1	1	1	1
201400	1	1	1	1	1	1	1	1	1
201500	1	1	1	1	1	1	1	1	1
201600	1	1	1	1	1	1	1	1	1
201700	1	1	1	1	1	1	1	1	1
201800	1	1	1	1	1	1	1	1	1
201900	1	1	1	1	1	1	1	1	1

Fig 7. Example of type 1 message printout.

PAGE = 1

TIME	STATION	COMMAND	CHANNEL	GR	CM	CODE	TYPE	MESSAGE	RESPONSE	PARITY	MANUAL	DATA	FILE	RAW DATA
HR	MM	SS												
19	28	13	245	9		1	28		RT	3		11312474672124232501	1	
19	28	14	255	7		1	28		RT	3		0731249502254232501	1	
19	28	14	266	1		1	28		RT	3		0131249502254232501	1	
19	28	14	268	5		1	28		RT	3		05312495022604232501	1	
19	28	14	269	2		1	28		RT	3		0231249502264232501	1	
19	28	14	259	6		1	28		RT	3		0631249502264232501	1	
19	28	14	260	32		1	28		RT	3		04312495023004232501	1	
19	28	14	260	4		1	28		RT	3		03312495023024232501	1	
19	28	14	261	1		1	28		RT	3		10312495023064232501	1	
19	28	14	262	6		1	28		RT	5		11312495023064232501	1	
19	28	14	262	8		1	28		RT	3		0631249508120871301	1	
19	28	14	628	32		36	1					0731249542408622501	1	
19	28	16	253	7		1	1					13312495660201282701	1	
19	28	17	629	12		3	1					14312495661221042701	1	
19	28	20	559	32		37	1					083124980262631501	1	
19	28	20	844	14		3	1					1631249810210162701	1	
19	28	21	842	32		66	1					06312498202041371401	1	
19	28	21	354	6		1	1					1031249832508062501	1	
19	28	25	501	32		36	1					063124985028651301	1	
19	28	25	827	7		1	1					073124985028651301	1	
19	28	26	192	32		35	1					063124985028651301	1	
19	28	27	718	12		3	1					163124987001302701	1	
19	28	28	384	11		3	1					133124987001302701	1	
19	28	30	303	32		34	1					063124988001251101	1	
19	28	30	830	32		37	1					063124988001251101	1	
19	28	31	421	8		1	1					103124988001251101	1	
19	28	36	857	32		36	1					063124988001251101	1	
19	28	37	317	32		35	1					063124988001251101	1	
19	28	38	831	12		3	1					143124988001251101	1	
19	28	40	467	32		34	1					063124988001251101	1	
19	28	41	864	32		37	1					063124988001251101	1	
19	28	43	788	11		3	1					133124988001251101	1	
19	28	44	859	32		18	1					063124988001251101	1	
19	28	46	395	6		1	1					103124988001251101	1	
19	28	48	665	32		36	1					063124988001251101	1	
19	28	48	350	32		3	1					163124988001251101	1	
19	28	48	849	12		34	1					063124988001251101	1	
19	28	50	471	32		37	1					063124988001251101	1	
19	28	51	452	32		37	1					133124988001251101	1	
19	28	54	759	11		3	1					063124988001251101	1	
19	28	54	335	32		36	1					063124988001251101	1	
19	28	58	787	12		3	1					103124988001251101	1	
19	28	59	118	8		1	1					163124988001251101	1	
19	28	59	748	32		35	1					063124988001251101	1	
19	29	1	766	32		37	1					063124988001251101	1	
19	29	4	893	11		3	1					133124988001251101	1	
19	29	4	484	12		3	1					143124988001251101	1	

Fig 8. Example of digital dump, giving time and content of all sensor signals.

The seismic sensors activated for traffic, rain, thunder, and possibly wind. One sensor string was only 100 meters from a paved road, and oriented parallel to the road. Traffic could be detected very well from the sensor returns (Figure 9). By examining the X-T plot, even the speed of the vehicles could be calculated. Analysis of rainfall data from this string was usually unfruitful because of these high traffic levels. At times, traffic would also cause activations on the second string east of the road. At other times, three strings were affected at the same time by what was suspected to be aircraft traffic. Thunder at times caused activations over the entire sensor field. On several days, the rainfall pattern was difficult to recognize on the seismic returns due to frequent activations from thunder. We suspected that some periods of otherwise unexplained activations were caused by wind, either directly by moving the sensor antennas or indirectly by tree movement. However, wind data were insufficient to establish any relationships.

We understood at the outset that the seismic sensors could transmit once every 10 seconds, giving a maximum activation rate of six per minute. However, we occasionally observed reports of seven activations per minute, and on 25 November one sensor transmitted seven times per minute for seventeen consecutive minutes. The ADTC Sensor Lab verified that the specifications for the inhibit circuit, which controls the activation interval, is 10 ± 2 seconds on the ADSID III and ACOSID III. The control in this circuit is a resistance-capacitance (R-C) network. If seismic movements of sufficient intensity and frequency are reported by the sensor's geophone and build up a certain level of charge in other circuit elements, the sensor will transmit an "activation," provided the time constant of the R-C network is exceeded. Thus, during times of high levels of seismic movement, the sensor can transmit every time this time constant is exceeded. We observed this "saturation" to occur frequently during heavy rainfall. The time constant varied from 8.5 to 11.0 seconds on different sensors, but remained essentially the same for each sensor from day to day.

Activation and saturation levels are highly dependent on gain setting. Gain setting affects the level of seismic activity required to trigger the geophone. For a given level of seismic activity, increased gain setting results in more frequent triggering of the geophone. For each output from the geophone, a certain amount of charge builds up in another circuit element. This charge, however, has a certain decay rate. Outputs from the geophone must occur frequently enough to overcome this decay rate and build up the required level of charge before the sensor will transmit any activations. The higher the seismic level, the more frequent the outputs from the geophone and the more rapid the charge buildup to the critical level. Thus, higher gain settings not only lower the threshold level of seismic activity required for activation, but also lower the level of activity required for saturation. The sensors in each string were set at the same gain setting, two strings on gain 3 and two on gain 4. However, there was still a wide variation in the sensitivity of the various sensors in a string. This was especially noticeable during periods of light rainfall. After 10 November, when all four rain gauges were moved to the one sensor string, we were able to determine with some certainty that these

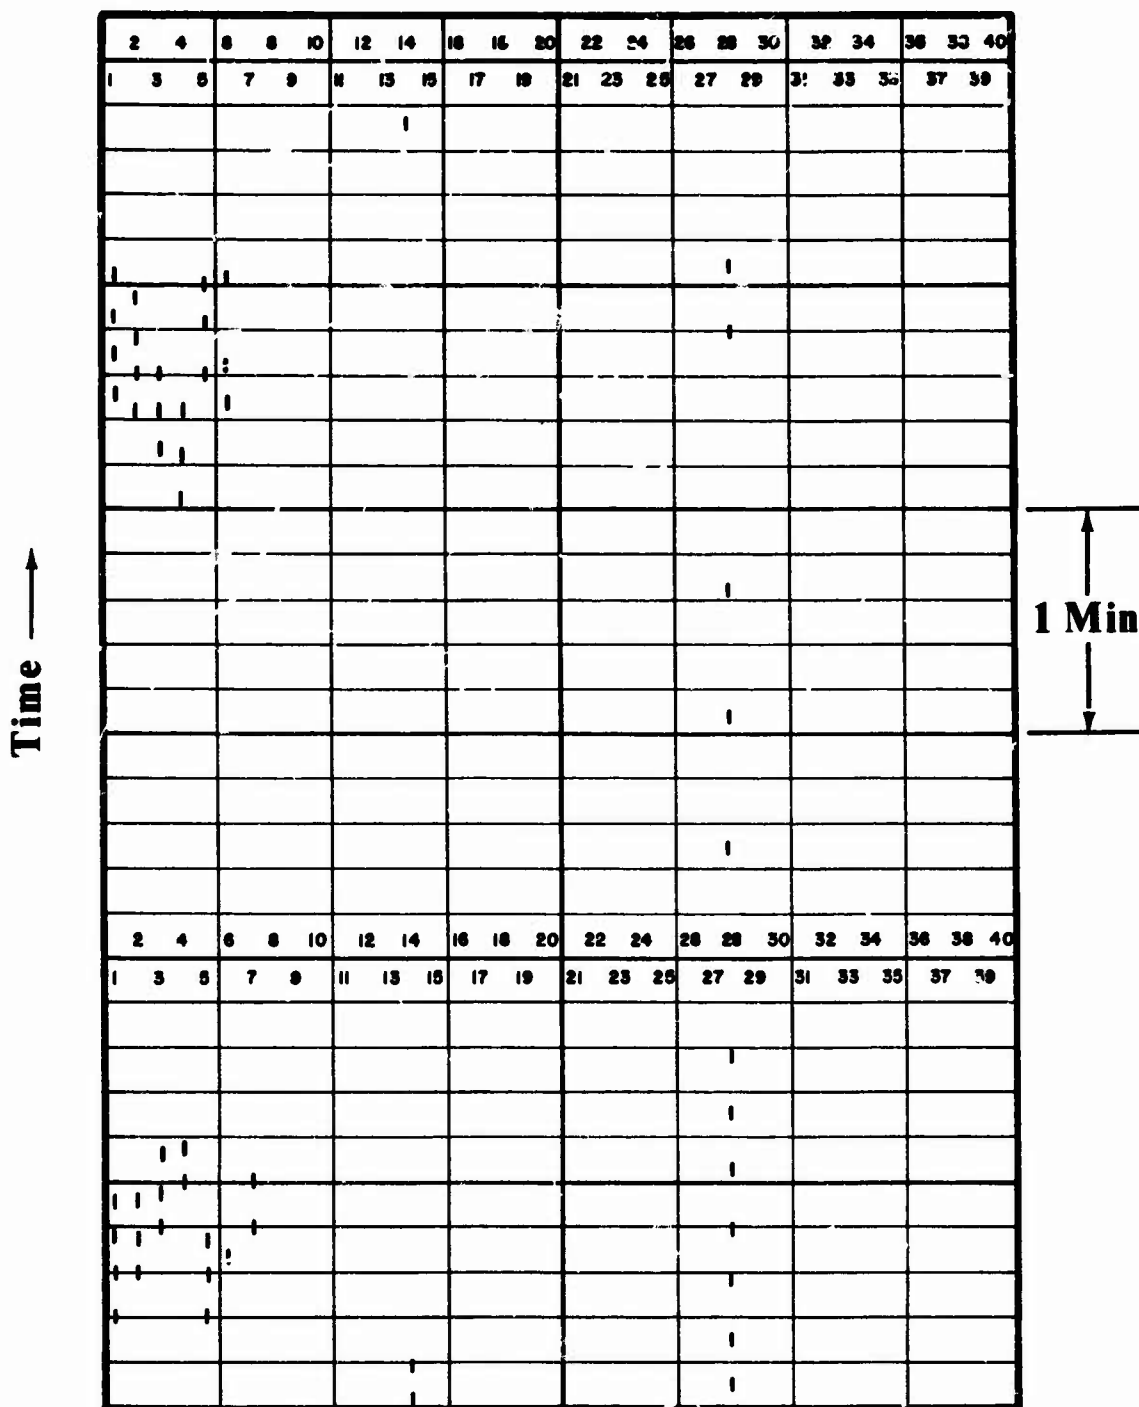


Fig 9. Example of activations caused by vehicular traffic. Channels 1, 2, 3, and 4 are ACOUSIDs (200 m. apart) and 5, 6, 7, and 8 are ADSIDs (200 m. apart) in the power line string. The two groups of activations are from traffic moving north and south on the highway. The heavy time divisions are approximately one minute.

variations were due to sensor sensitivity rather than to variations in rainfall along the string.

The seismic data from the ACOUSIDs for all tests before 25 November were not used in the comparisons, since during part or all of the rainfall periods the ACOUSIDs were being commanded for acoustic returns, and seismic activations are not transmitted during the acoustic transmission cycle.

Individual Comparison Results - Following is a discussion of the data collected for each test day and the comparison of the rainfall and sensor data, with a quantitative summary of the comparisons.

DATE: 25 September 1972

SENSORS: Two main periods of activations occurred from 1929Z to 1945Z and 2130Z to 2145Z. The sensor string nearest the highway activated at various levels every few minutes for traffic. ADSID #37 activated almost continuously and #32 activated only five times during the entire test. Both were disregarded. The operators added many valuable comments on the X-T plot regarding rain and wind. Both periods of heavy rain were preceded by strong winds. Data were acquired from 1929Z to 2230Z.

RAINFALL: Most of the rainfall occurred in the form of two showers, at about 1930Z and 2130Z. The first shower nearly missed the two eastern gauges, moving from SSE. The second shower was recorded on all gauges. The pen drive slipped on Gauge #2. However, the data for the first shower appeared reasonable. An obstruction in the collecting funnel on gauge #4 slowed the flow of water, so rates were unusable.

COMPARISONS/CONCLUSIONS: Rainfall times correlated well with maximum sensor activations. During the first shower, with rainfall rate 1.25"/hour, the three ADSIDs evaluated (gain 4) approached saturation for about a minute. The rate during the heaviest part of the second shower was about 3"/hour on both #1 and #3 gauges. ADSID #18 (gain 3) saturated at 10.0 second intervals for two minutes. ADSIDs #34 and #36 (both Gain 4) saturated for 8 and 6 minutes, at 9.5 and 10.1 second intervals, respectively. Comparisons listed below are averages over the entire period of the showers for all of the sensors considered.

<u>GAIN 3</u>		<u>GAIN 4</u>	
<u>RAINFALL RATE</u> (inches/hour)	<u>SENSOR COUNT</u>	<u>RAINFALL RATE</u> (inches/hour)	<u>SENSOR COUNT</u>
2.0	4.2	2.0	5.5
		1.25	4.8
		0.46	3.7

DATE: 23 October 1972

SENSORS: Seven ADSIDs were inoperative. The returns from the other ADSIDs were in 5 to 15 minute blocks, many of them uncorrelated in time, plus scattered low counts throughout the test period. Data period 1526Z - 2244Z.

RAINFALL/WIND: Rainfall occurred in the test area from approximately 1040Z to 1840Z. Most of the heavier precipitation occurred during the sensor data period. The rainfall was generally light to moderate with brief heavy showers. The rainfall records looked very good, but timing was a problem. Number two gauge exhibited extremely rapid chart speed. Gusty winds (up to 25 kts) were recorded between 1315Z and 1855Z.

COMPARISONS/CONCLUSIONS: Since time correlation was difficult and the heavier showers appeared to be brief and localized, each rain gauge record was compared only to returns from the adjacent sensor string and, in one instance, to one sensor. No activations could be attributed to wind. The activation rates from the ADSIDs set on gain 3 were much lower than the rate from those set on gain 4. Therefore, results are compiled separately. Activations from the sensor string nearest the road showed a high rate of vehicular traffic, making rainfall difficult to discern. The 0.5 and 0.67 inches/hour rates are not instantaneous rates, but are results of smoothing through a period of rapidly fluctuating rainfall. During a period of 1.5 inches/hour rainfall, two ADSIDs on gain 4 appeared to saturate briefly.

<u>GAIN 3</u>		<u>GAIN 4</u>	
<u>RAINFALL RATE</u> (inches/hour)	<u>SENSOR COUNT</u>	<u>RAINFALL RATE</u> (inches/hour)	<u>SENSOR COUNT</u>
2.0	2.8	1.5	5.7
1.3	1.8	1.3	5.2
1.0	1.6	0.5	3.8
1.0	1.4	0.5	3.3
0.67	1.9	0.5	2.9
0.20	0.0		

February 1974

Technical Report 74-253

DATE: 26 October 1972

SENSORS: The sensor string nearest the highway had numerous brief periods of activations and one nine-minute period with counts up to six per minute. The other strings had very sporadic activations throughout the period. Period of data: 2338Z to 27/0431Z.

RAINFALL: Light rain (less than 0.05"/hr) began at about 2300Z and continued until about 27/0330Z. Brief moderate showers with rates up to 0.5"/hr occurred near 27/0200Z and 0300Z.

COMPARISONS/CONCLUSIONS: All of the activations on the sensor string near the road and the next string to the east appeared to be caused by traffic. These were all set at gain 3. The moderate showers that occurred along these two strings were too brief for an accurate calculation of rainfall rates, but they were about 0.3"/hr. No activations could be attributed to these showers. On the eastern-most string (gain 4) these showers triggered a two-minute period of activations which average 1.3 counts. The one shower with 0.5"/hr rate appeared to occur only on the northwest end of the western string, where the last three ADSIDs were inoperative, and therefore triggered no activations. The light continuous rain caused no activations on the gain 3 sensors and only isolated activations on the gain 4 sensors.

<u>GAIN 3</u>		<u>GAIN 4</u>	
<u>RAINFALL RATE</u> (inches/hour)	<u>SENSOR COUNT</u>	<u>RAINFALL RATE</u> (inches/hour)	<u>SENSOR COUNT</u>
0.3	0.0	0.3	1.3
0.05	0.0	0.05	0.0

DATE: 27 October 1972

SENSORS: Period of the data was 1211Z to 1414Z, 1535Z to 1652Z, and 1832Z to 1907Z. High activation levels were occurring at the beginning of the test and continued until 1300Z. Eight ADSIDs were out of commission. Operator remarks on the X-T plot gave changes in intensity of rainfall at the Blue Goose, which correlated very well with the sensor activations.

RAINFALL/WIND: Rain had begun near 0500Z, consisting of several periods of relatively light rain. Heavy showers began at about 0900Z. By 1000Z, the two rain gauges with the higher rate of pen travel had malfunctioned: the pen arms had travelled all the way across the paper and failed to reverse. By 1240Z the other two gauges had overflowed. Total rainfall amount was over three inches. Rates exceeded four inches per hour in the heavier showers. Wind gusts to 37 knots accompanied the heavy rain.

COMPARISONS/CONCLUSIONS: Due to the limited period of time that both the sensors and rain gauges were operating and the timing difficulties on the rain records, no comparisons could be made. However, it appeared reasonably certain that the sensors were operating during one period of 4"/hr rainfall. Activations during that period were analyzed for saturation. ADSIDs #34 and #35, gain 4, saturated at 9.7 and 11.0 seconds. ADSID #22, gain 3, saturated at 10.3 seconds; but ADSID #31, also gain 3, did not saturate at all.

February 1974

Technical Report 74-253

DATE: 7 November 1972

SENSORS: Five ADSIDs were not operational. The three strings east of the highway had sporadic activations throughout the period. The string to the west had a 20-minute period of activations near the beginning of the test and only isolated activations thereafter. Data times were 2002Z - 2156Z.

RAINFALL: Approximately twenty minutes of light rain occurred at gauges #2 and #4 during the test period. Brief light showers occurred at all gauges before and after the test period. Total accumulation was 1/16 inch.

COMPARISONS/CONCLUSIONS: The two ADSIDs operating in the string nearest the highway had activations averaging 1.5 and 1.0 counts per minute during the rain period. However, some traffic is evident on the X-T plot during the period, and the strings to the east also experienced activations at the same times, where no rainfall was recorded. Therefore, we concluded that a comparison of these activations to rainfall rate would be invalid. Another period of activations on the eastern-most string, which lasted for 22 minutes, did not correspond to rainfall or other sensor activations. The area east of the highway was to be opened for hunting on 11 November. Possibly a large part of the activations on the three eastern strings were caused by hunters reconnoitering the area. The string west of the Goose (gain 1) had a period of activations which correspond well with the rainfall times and rates.

<u>RAINFALL RATES</u> (inches/hour)	<u>SENSOR COUNTS</u>
0.14	2.8
0.05	0.9

DATE: 10 November 1972

SENSORS: This was the first test day with only one sensor string. All ADSIDs were operating. The periods of activation corresponded fairly well, but the levels of sensitivity varied considerably. All were on gain setting 4. Operator remarks on the X-T plot described rain intensities at the Goose, including "plenty lightning and thunder" at the beginning of the test. Test period: 2109Z - 2345Z.

RAINFALL: All four gauges showed the same rainfall pattern: Approximately 6 minutes of moderate rain, 10 minutes of light rain, 10 minutes of heavy rain, 25 minutes of no rain, and then 20 minutes of moderate rain. There was a time discrepancy of about 10 to 12 minutes between the gauges, so some adjustment was made. The time discrepancy could not be attributed to the movement of the storm, since the gauges were now all along one sensor string. The total rainfall was about 0.7 inch and occurred from 2130Z to 2300Z.

COMPARISONS/CONCLUSIONS: This test was the best in the series for comparison of rainfall and sensor data. The times compared favorably, showers were of sufficient duration to make accurate analyses, and several different rates occurred. Due to the apparently different levels of sensitivity of the ADSIDs, activation levels were computed separately. During the period of light rain following the first shower, considerable thunder occurred, activating the sensors. Therefore, no comparison was made for that period. Also, the series of smaller showers near the end of the rain period varied in intensity from one end of the string to the other, so the rate computed from the nearest rain gauge was used in the comparison. During the first shower (1.3 inch/hr), ADSIDs #66, #55, and #52 saturated, but #46 did not. During the heavy shower (2.5 inch/hr), all ADSIDs saturated. The time interval was 10.5 seconds for #66, 10.4 for #55, 10.9 for #52, and 10.6 for #46.

<u>RAINFALL RATES</u> (inches/hour)	<u>SENSOR COUNTS</u>				<u>AVERAGE</u>
	<u>#66</u>	<u>#55</u>	<u>#52</u>	<u>#46</u>	
2.5	5.7	5.4	5.4	5.3	5.5
1.3	5.7	5.6	5.6	3.4	5.1
0.13	0.8	2.6			1.7
0.1			3.0		3.0
0.04				0.0	0.0

February 1974

Technical Report 74-253

DATE: 13 November 1972

SENSORS: ADSID #46 was inoperative. A high level of activations occurred from 1812Z to 1935Z and 2024Z to 14/0034Z. The level of activations among sensors varied considerably at several times during the test. Operator remarks on the X-T plot were very helpful in determining times of start and stop and change of intensity of rainfall, as well as occurrence of wind and thunder. Period of test: 13/1804Z - 14/0137Z.

RAINFALL: The first period of rain was from 1805Z to 1930Z, with rates up to 1 inch/hr. The second period, with maximum rate up to 4 inch/hr, began at 13/2150Z and ended at 14/0030Z. There was generally good agreement in times and rates between the gauges. Number 1 gauge was inoperative and #2 malfunctioned between 2300Z and 0000Z. Total accumulation varied from 1-1/8 inch to 1-7/16 inch.

COMPARISONS/CONCLUSIONS: Evaluation of the data was extremely difficult. Activation levels were unexplainably high during the first four hours. Wind and thunder may have been responsible. The first rainfall period was only recognizable on ADSID #52, but activation levels were too high, especially at the end of the rainfall period. During the second rainfall period, ADSIDs #55 and #52 activated at the 5.5 level, regardless of rainfall intensity, throughout and even for some time following the rainfall period. A reasonable comparison was obtainable from ADSID #66, however, which is listed below. All three ADSIDs saturated during the period when the rainfall rate was slightly over 1 inch/hr. The minimum interval was 10.6 seconds for #66, 10.5 for #55, and 10.9 for #52. All sensors were set on gain 4.

<u>RAINFALL RATES</u> (inches/hour)	<u>SENSOR COUNTS</u>
4.0	5.8
2.0	5.8
1.0	5.6
1.0	5.2
0.5	5.5
0.2	3.9
0.1	3.9
0.05	1.4

DATE: 25 November 1972

SENSORS: During this test and for the remainder of the test series, the ACOUSIDs were not commanded for acoustic data. Therefore, they were acting essentially as ADSIDs. This was also the test that prompted our investigation of minimum activation times and saturation by heavy rain. ACOUSID #970 responded seven times per minute for 17 consecutive minutes. Counts were generally one or two per minute higher from it than from the neighboring ADSID. ADSIDs #55 and #52 activated almost continuously throughout the test and their data were disregarded. ACOUSID #1564 was inoperative and ACOUSID #1450 had slipped to gain 3. A significant difference in activation levels from the usable sensors was apparent in the data, but all showed the same general pattern of starts and stops. The period of data was 1408Z - 1550Z.

RAINFALL: Due to malfunctions, data were available from only two gauges. Even then, the amount of rainfall measured in the collecting tube on gauge #2 was 1-1/4 inch, but the chart indicated less than an inch. By comparing the chart to that from gauge #1, it was determined that the perforated steel tape which drives the pen arm mechanism had slipped during the heaviest rain, and therefore data after that point were unusable. The chart speed calculations for gauge #1 indicated unusually rapid chart speed, but this was not borne out in comparison with the chart from gauge #2. The general pattern of rainfall had to be adjusted to a best fit with the sensor activations and the operators' remarks. About 1/3 inch of rain had fallen before the sensor test began, and light rain was falling as the test began. The rainfall during the test consisted of one 25-minute period of heavy rain (1.6 inch/hr) and several periods of moderate rain. Light rain was still falling at the conclusion of the test.

COMPARISONS/CONCLUSIONS: A reasonable fit was found in the sensor and rainfall data. However, the activation levels from the various sensors varied considerably, as the figures below indicate. All four of the gain 4 sensors considered in the analysis saturated during the 1.6 inch/hr rainfall. The time interval was 8.6 seconds for ACOUSID #970, 10.7 for ADSID #66, 9.1 for ACOUSID #1396, and 10.7 for ADSID #46.

<u>RAINFALL RATES</u> (inches/hour)	<u>SENSOR COUNTS</u>					<u>AVERAGES - GAIN 4</u>	
	<u>#970</u>	<u>#66</u>	<u>#1396</u>	<u>#46</u>	<u>#1450</u> (gain 3)	<u>ACOUSID</u>	<u>ADSID</u>
1.6	6.9	5.4	5.6	5.5	1.0	6.3	5.5
1.0	6.7	5.3	3.7	5.0	0.0	5.2	5.2
0.5	5.9	2.7	1.0	3.0	0.0	3.5	2.9
0.5	6.0	2.7	1.0	3.0	0.0	3.5	2.9
0.4	4.2	3.3	0.5	2.5	0.1	2.4	2.9
0.3	3.9	2.7	0.9	2.0	0.0	2.4	2.4
0.1	1.0	0.0	0.0	0.0	0.0	0.5	0.0
0.1	0.8	0.0	0.0	0.0	0.0	0.4	0.0

February 1974

Technical Report 74-253

DATE: 4 December 1972

SENSORS: ADSID #52 had numerous activations during the entire test while the other sensors had only isolated returns.

RAINFALL: Only one of the four rain gauges measured the light rain (less than 0.12 inch/hr) that fell during this entire test.

COMPARISONS/CONCLUSIONS: For the light rainfall observed, ADSID #52 reflected the start and stop times very well (within 2 minutes). However, the counts/minute were quite unreasonable, especially since no other sensors were activated. It was possible that the gain on this particular sensor had slipped. The rainfall rate of 0.12 inch/hr produced activations of 4.7 counts/minute. Because of the inconsistencies these data were not included in the summary.

DATE: 5 December 1972

SENSORS: ADSID #52 had a much higher level of activations than the other sensors during the more quiet periods, and its data were not considered in the analysis. The type one computer output showed several counts of 8, 9, and 11 per minute for ACOUSID #970 which were not borne out on the X-T plot. The overall activation pattern showed two brief periods of high activations at the beginning of the test followed by an hour and 20 minutes of low levels, 40 minutes of high levels, and finally 30 minutes of low levels. Operator's comments on the X-T plot gave a good description of the changes in rainfall intensity, thunder, and wind. Period of data was 05/2118Z - 06/0000Z.

RAINFALL/WIND: A brief shower(1 inch/hr) at the beginning of the test was followed by 90 minutes of variable, mostly light, rain, 30 minutes of heavy rain (up to 4 inches/hr), and finally 45 minutes of lighter showers. Accumulation during the test period was one inch. Three hours later, another period of heavy rain brought the evening's total rainfall to 2.9 inches. Wind was light except for a period of gusts up to 32 knots near 2300Z. The rain gauge records had time discrepancies of up to 25 minutes. One gauge had unusually slow chart speed and another malfunctioned during the heavy rain period.

COMPARISONS/CONCLUSIONS: A good fit between the rainfall pattern and sensor activation levels was found. However, the sensitivity of the individual sensors varied considerably, especially for the lower rainfall rates. The excessive activation rate indicated for ACOUSID #970 was due to activations of another sensor nearby which was on the same frequency and had been implanted for surveillance of the closed hunting area. This sensor was set at a lower gain setting, and its activations were only received during the heaviest rainfall. After examining the digital dump for activation times, it was decided that all of the excessive counts for ACOUSID #970 could be changed to 7 counts per minute. All sensors saturated for rainfall of 2 inches/hr or higher, with the following minimum interval: 8.5 seconds for ACOUSID #970, 10.6 for ADSID #66, 9.5 for ACOUSID #1564, 10.6 for ADSID #55, 8.8 for ACOUSID #1450, 9.1 for ACOUSID #1396, and 10.7 for ADSID #46. In the summary below, most of the sensors show a higher count rate for the 4 inch/hr rainfall than for the 2 inch/hr rainfall, which seems to contradict the finding that all sensors were saturated at 2 inches/hr. The 4 inches/hr rainfall lasted only 3 or 4 minutes. The timing of the activations within the one minute summaries can lead to different counts during such short periods.

RAINFALL RATES (inches/hour)	SENSOR COUNTS							AVERAGES	
	#970	#66	#1564	#55	#1450	#1396	#46	ACOUSID	ADSID
4.0	7.0	5.5	6.5	5.5	7.0	6.5	5.8	6.8	5.6
2.0	6.9	5.5	6.3	5.6	6.7	6.3	5.4	6.6	5.5
1.0	6.9	4.8	6.1	5.5	6.6	5.8	4.8	6.4	5.0
0.7	5.5	4.3	3.6	5.5	6.3	3.4	4.5	4.7	4.8
0.5	4.7	3.4	3.0	4.0	3.3	1.4	1.2	3.1	2.9
0.125	3.9	2.6	1.8	4.2	2.0	1.0	1.0	2.2	2.6
0.05	1.9	0.0	0.6	2.0	0.7	0.2	0.3	0.9	1.1

February 1974

Technical Report 74-253

DATE: 6 December 1972

SENSORS: Two periods of activations occurred, 1633Z to 1711Z and 2039Z to 2100Z. In both instances, ADSID #52 continued transmitting for 15 to 25 minutes after all other sensors had stopped; therefore, its activations could not be used in the analysis. ACOUSID #790 had been removed and taken to the lab for frequency change due to the presence of another sensor in the area on the same frequency. It was given a radio frequency code of 1390, and then reimplanted during the first period of activations of the test. Period of data was 1626Z - 2201Z.

RAINFALL: Moderate rain fell between 1620Z and 1711Z and between 2032Z and 2115Z. The first period was characterized by moderate showers (0.5 inch/hr) interspersed with brief periods of light rain. The second period of rain was somewhat lighter (0.33 inch/hr) and steadier, tapering off gradually at the end. Total accumulation was 3/8 inch. The pattern, except for timing problems, compared favorably from gauge to gauge. Data were available from three gauges.

COMPARISON/CONCLUSIONS: Activations during the first rainfall period clearly depicted the showery nature of the precipitation. Since the individual showers were very brief, the rainfall rates used for comparison were averages rather than instantaneous rates. Considerable variation in sensor count rates occurred even though all sensors were at gain 4. The second period of rainfall presented an interesting case. The rate was high enough that a response should have been expected from all sensors. Yet only ADSIDs #52 and #55 started transmitting when the rain began. Number 55 stopped at the end of the rainfall, but #52 continued on for 25 minutes. The other sensors activated either for only the heaviest portion of the rainfall or not at all. Operator's comments on the X-T plot only referred to light rain during this period, when in fact, rates were as high as .5 inch/hr during part of the period. It was possible that drop size during this period was small, leading to the indications of light rain and low activation rates.

RAINFALL RATES (inches/hour)	SENSOR COUNTS							AVERAGES	
	#1390	#66	#1564	#55	#1450	#1396	#46	ACOUSID	ADSID
0.5	---	4.1	3.8	5.4	5.2	2.3	3.1	3.8	4.2
0.33	1.6	0.5	0.0	4.4	0.6	0.0	0.3	0.5	2.1
0.17	---	2.5	2.0	4.2	3.3	2.0	2.2	2.4	3.0

Combined Comparison Results - Obviously, the size of the data sample and the range of sensitivities of the various sensors do not warrant a sophisticated statistical analysis of the comparisons. Examination of the daily test results indicated that the data should be separated into three categories for analysis: the ADSID and ACOUSID gain 4 data, and all the gain 3 data. The reason for separating the ACOUSID and ADSID data is the apparently shorter response time and therefore higher activation levels of the ACOUSIDs during heavy rainfall. This separation of the data did reduce the size of each sample, but was determined to be necessary. Compilations of average and individual sensor counts were not "pure" data, because the number of sensors for which a comparison was available was different from day to day, and individual sensor rates were not computed for the days through 7 November. Graphs of sensor count vs rainfall rate were plotted, with separate graphs for individual sensor counts and average counts for the gain 4 data (Figures 10 through 14). Some adjustment was made for the heavier rainfall rates to account for the findings previously discussed on saturation rates. Various tables were also prepared, listing and averaging all rainfall rates observed within specified increments of sensor count, and for sensor counts computed within specified increments of rainfall rate, but these did not appear as instructive as the graphs. The large degree of data scatter for the lower rainfall rates may be attributed to several causes. First, the sensors have varying degrees of sensitivity, especially for these lower rates. Second, on the "average" graphs, the averages are for different sensors and different numbers of sensors in each case. Third, other effects, such as thunder, traffic, and wind, were present in varying degrees on different days. Fourth, the rainfall and sensor count rates computed were, because of the showery nature of the precipitation, not instantaneous rates, but rather averages of varying rates over a period of time. Finally, drop sizes may have been different for a given rate, causing different activation rates. Nevertheless, we believe that these graphs, especially the "average" graphs, can be used with a reasonable degree of assurance in analyzing sensor activation levels for rainfall rates.

Sensor Data - Acoustic Returns

All data received from the sensors were recorded on 14-track magnetic tape by the FR 1300 recorders. During the period 21 September - 13 November, the ACOUSIDs were commanded for acoustic data for various intervals. (After 13 November, we determined that continuous seismic monitoring was more valuable, since we were then operating with only one sensor string.) The written comments on the X-T plots indicated when acoustic data were being recorded. A total of 39 reels of tape were used on these tests.

With assistance from personnel of the Audio Distribution System of the "Music Box" Facility at Eglin AFB, selected portions of these magnetic tapes were replayed. An H. P. Sanborn 3900 tape recorder was used, and a time hack (accurate to one second) was displayed on a digital clock for reference to other data.

During the earlier portion of the test, ACOUSIDs were commanded about once a minute. Upon command, the sensor would transmit audio for 19 seconds, then

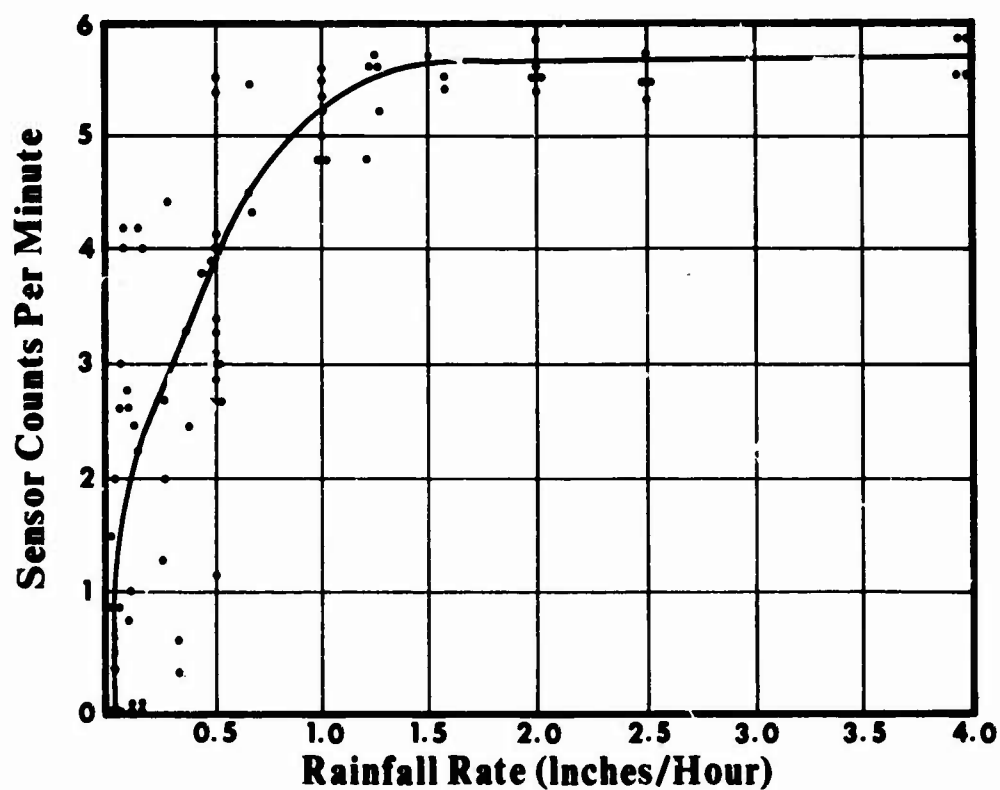


Fig 10. Individual gain 4 ADSID activation rate vs rainfall rate.

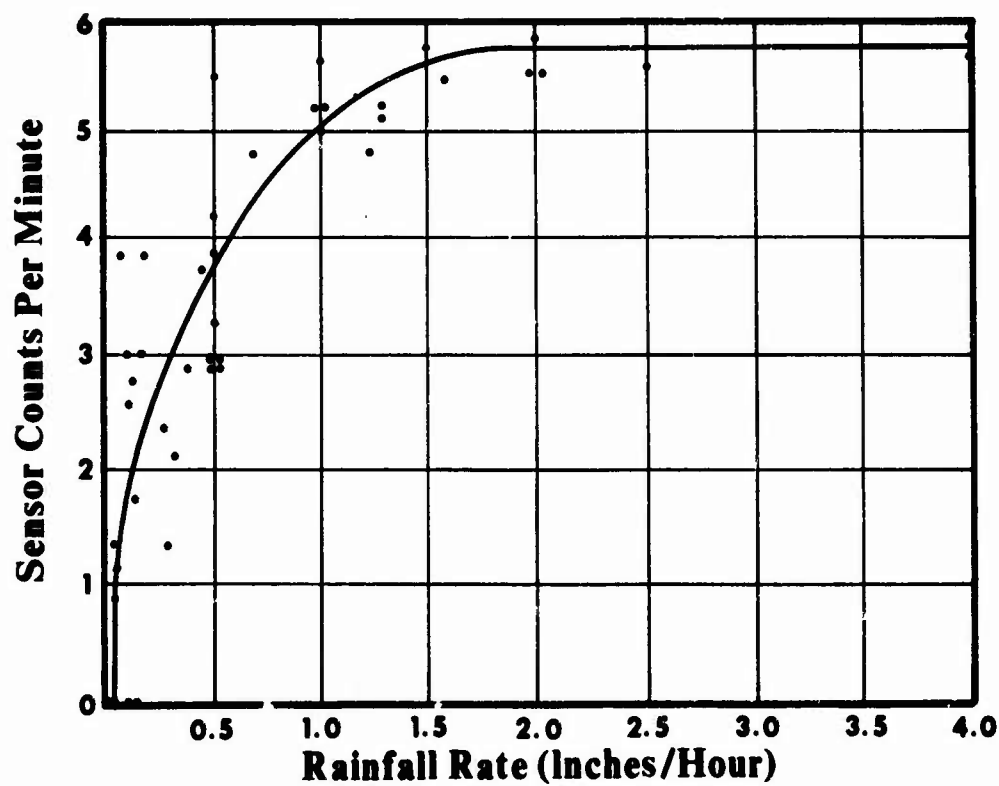
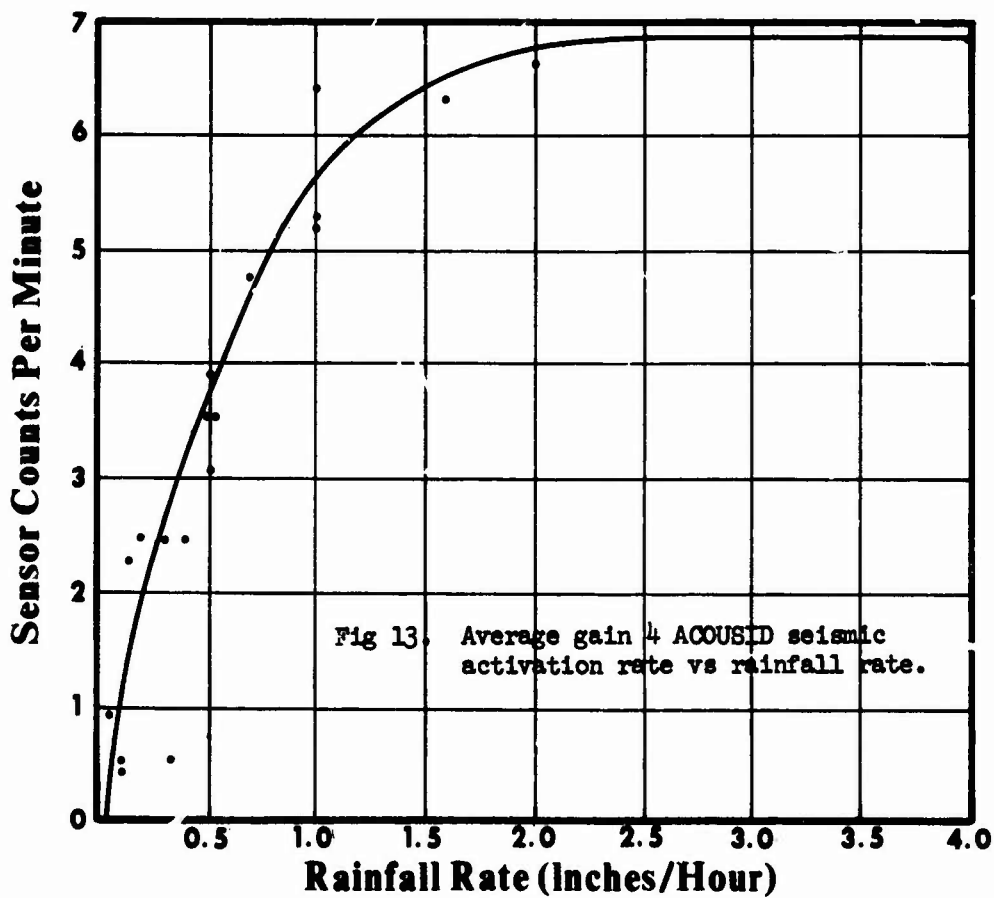
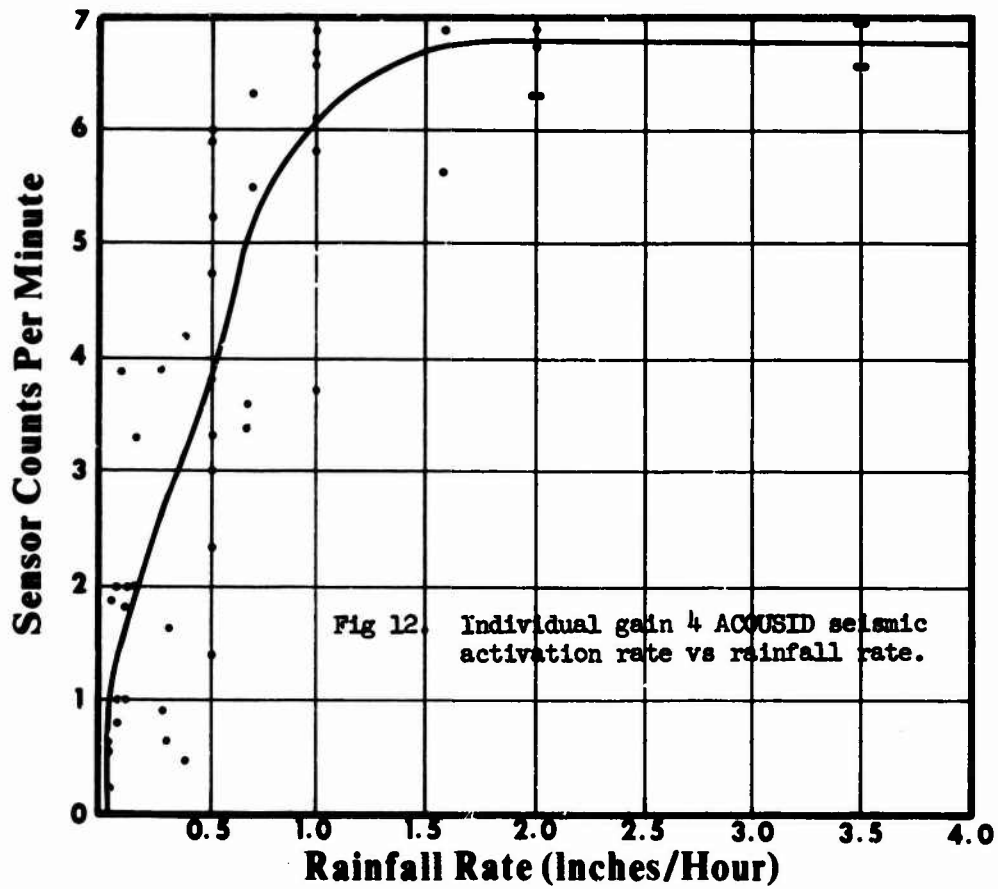


Fig 11. Average gain 4 ADSID activation rate vs rainfall rate.



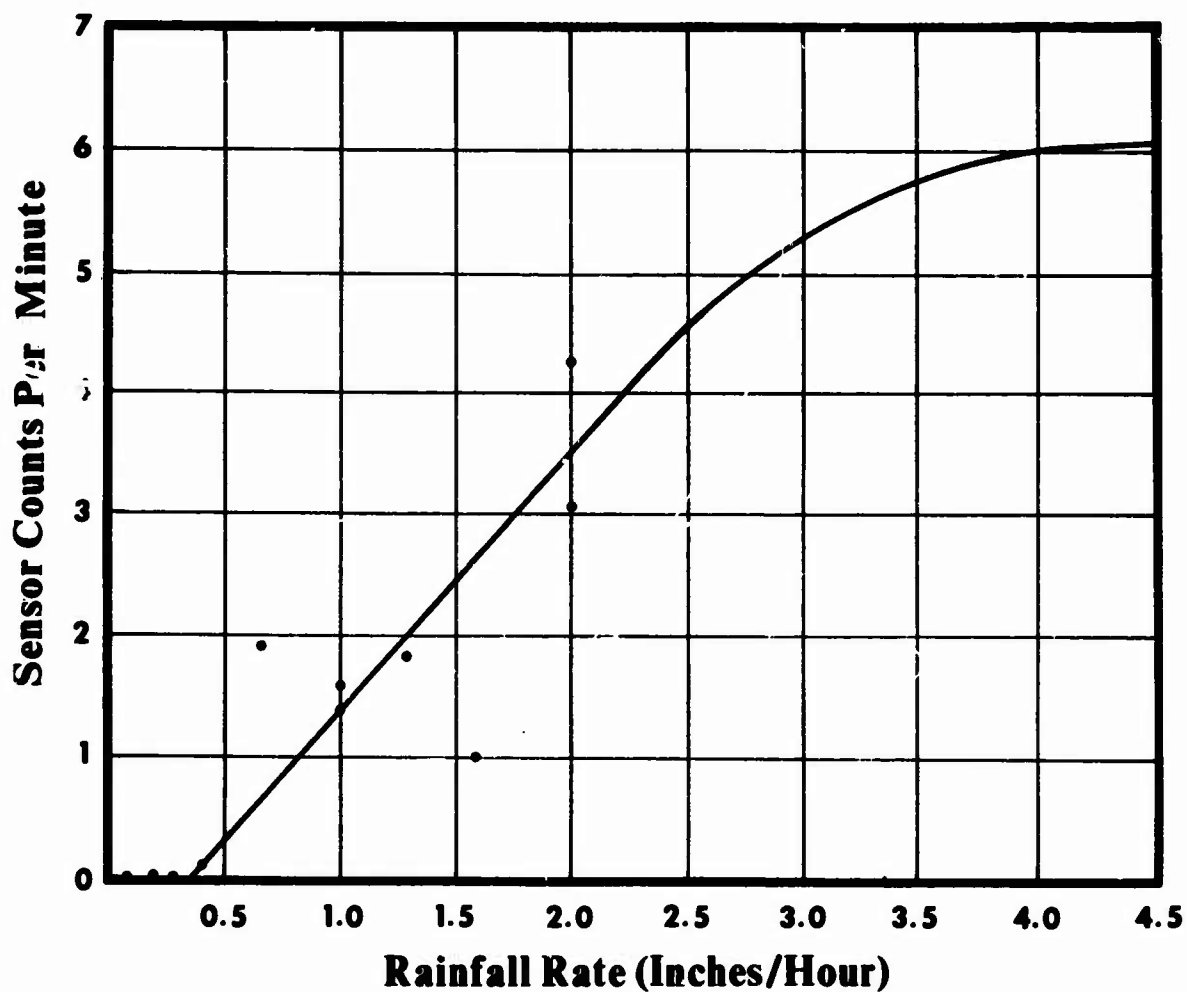


Fig 14. All gain 3 seismic activations vs rainfall rate.

<u>TIME</u>	<u>COMMENTS</u>	<u>TIME</u>	<u>COMMENTS</u>
2120Z	Start acoustic portion	2120Z	Start sensor-maybe light rain
2121	Very light rain	2121	Thunder
2121:05	Thunder	2122	Light to mod rain
2122	Increase to mod rain	2123	Mod rain
2123:25	Thunder	2123:21	Thunder
2125	Slight decrease in rain	2126	Rain decrease to light
2127	More decrease	2127:24	Little thunder
2128:50	Thunder	2129:25	Good thunder
2129:26	Thunder	2130	Light rain
2130	Rain decreasing more	2131	Thunder - lots
2130:28	Thunder	2132	More thunder
2131	Lots of thunder	2133	Rain almost stopped
2132	Light rain	2134	Thunder
2132:25	Lots of thunder	2135:05	Good thunder
2133:43	Thunder	2137	Almost nothing
2134	Very light rain	2140	Increase in rain-light to mod
2135:05	Thunder	2140:30	Good Thunder
2135	Light rain	2141	Down to light rain
2137:05	Thunder	2142	Up to mod rain
2139:33	Increase in rain to mod	2143	Heavy rain!
2140:25	Thunder	2144	Down to mod+ rain
2142:05	Now mod+ rain	2146:05	Thunder
2142:45	Heavy rain!	2147	Slight dropoff in rain to mod
2144	Slight decrease	2149	Slight, then big increase in rain
2145	Heavy to mod+ rain	2151	Down, then up, then down
2146:18	Thunder	2152	Light to very light. One short burst up, then down again.
2147	To mod, then heavy, then mod; up and down.		
2152	Decrease to light rain, then very light rain.		

Fig 15. Comparison of acoustic data received from two ACOUSIDs on 10 Nov 1972.

it would be off until commanded again. The noise level during these "silent periods" was so much greater than the actual audio that it became very difficult trying to evaluate the short periods of audio. However, on 26 September, 10 November, and 13 November, the audio commands were sent automatically every twenty seconds. Except for a loud beep every twenty seconds, the returns were continuous audio. Listening to these tapes was not only easier, but also very enlightening. On 26 September, the ADSIDs had been reporting some activations, yet no rain was in the area. By listening to the acoustic data, we could hear some traffic, both air and ground, occasional thunder, and some birds in the background. Nearby thunder completely saturated the ACOUSID response. On 10 November, there were over thirty minutes of continuous audio during a large thunderstorm with various rainfall rates. Figure 15 is a log of the data heard from two of the ACOUSIDs. On 13 November, there were numerous short sections of continuous audio, but the rainfall was not as variable. We had hoped to determine from the audio reports the reason for the high level of seismic activations in the absence of rainfall. Considerable thunder was heard throughout the period. Wind could not be detected in the audio signal. Only two ACOUSIDs were transmitting during the first rainfall period. The sounds from the two were similar, except that one was more sensitive. During the second rainfall period, one ACOUSID failed while the other was operating intermittently. Considerable thunder was still heard during the usable audio periods. We listened to the channel which recorded the COMMIKE signal on several of the tapes. We heard nothing but noise on any of the samples checked.

It was apparent from listening to the ACOUSIDs and from the logs that rainfall rates at the different sensors within a string changed at about the same time. This contrasted sharply to the 10 to 15 minute variations between the much more primitive rain gauge indications. Also, the changes in rain intensity heard in the audio signal corresponded very well in time to the changes in level of seismic activations. This was valuable in analyzing the data for 10 November, when seismic activation levels remained high during light or no rain periods because of thunder. We could see no way of quantitatively adjusting the seismic count during rainfall periods for activations caused by other phenomena, such as thunder, so these periods were excluded in the comparisons.

A video display of the audio returns for selected test periods was made on an H. P. Sanborn 7702 strip chart recorder for ACOUSIDs #970 and #1564 on 10 November. A portion from #970 is shown in Figure 16. A time hack was placed on the chart every minute. By comparing the width of the trace, one can readily see the changes in rainfall intensity. Also evident on the chart are the 19-second "beeps" and the response from thunder. Thunder caused the recorder pens to impact on both ends of the scale, frequently damaging the pens. By reducing the gain on the recorder, the responses from thunder could be kept within range, but the rainfall detail was lost. These strip charts were useful as an aid in separating the seismic activations due to thunder from those caused by rainfall. However, if the activations which occurred from thunder were removed from the seismic count, it still could not be determined whether rainfall would have triggered the

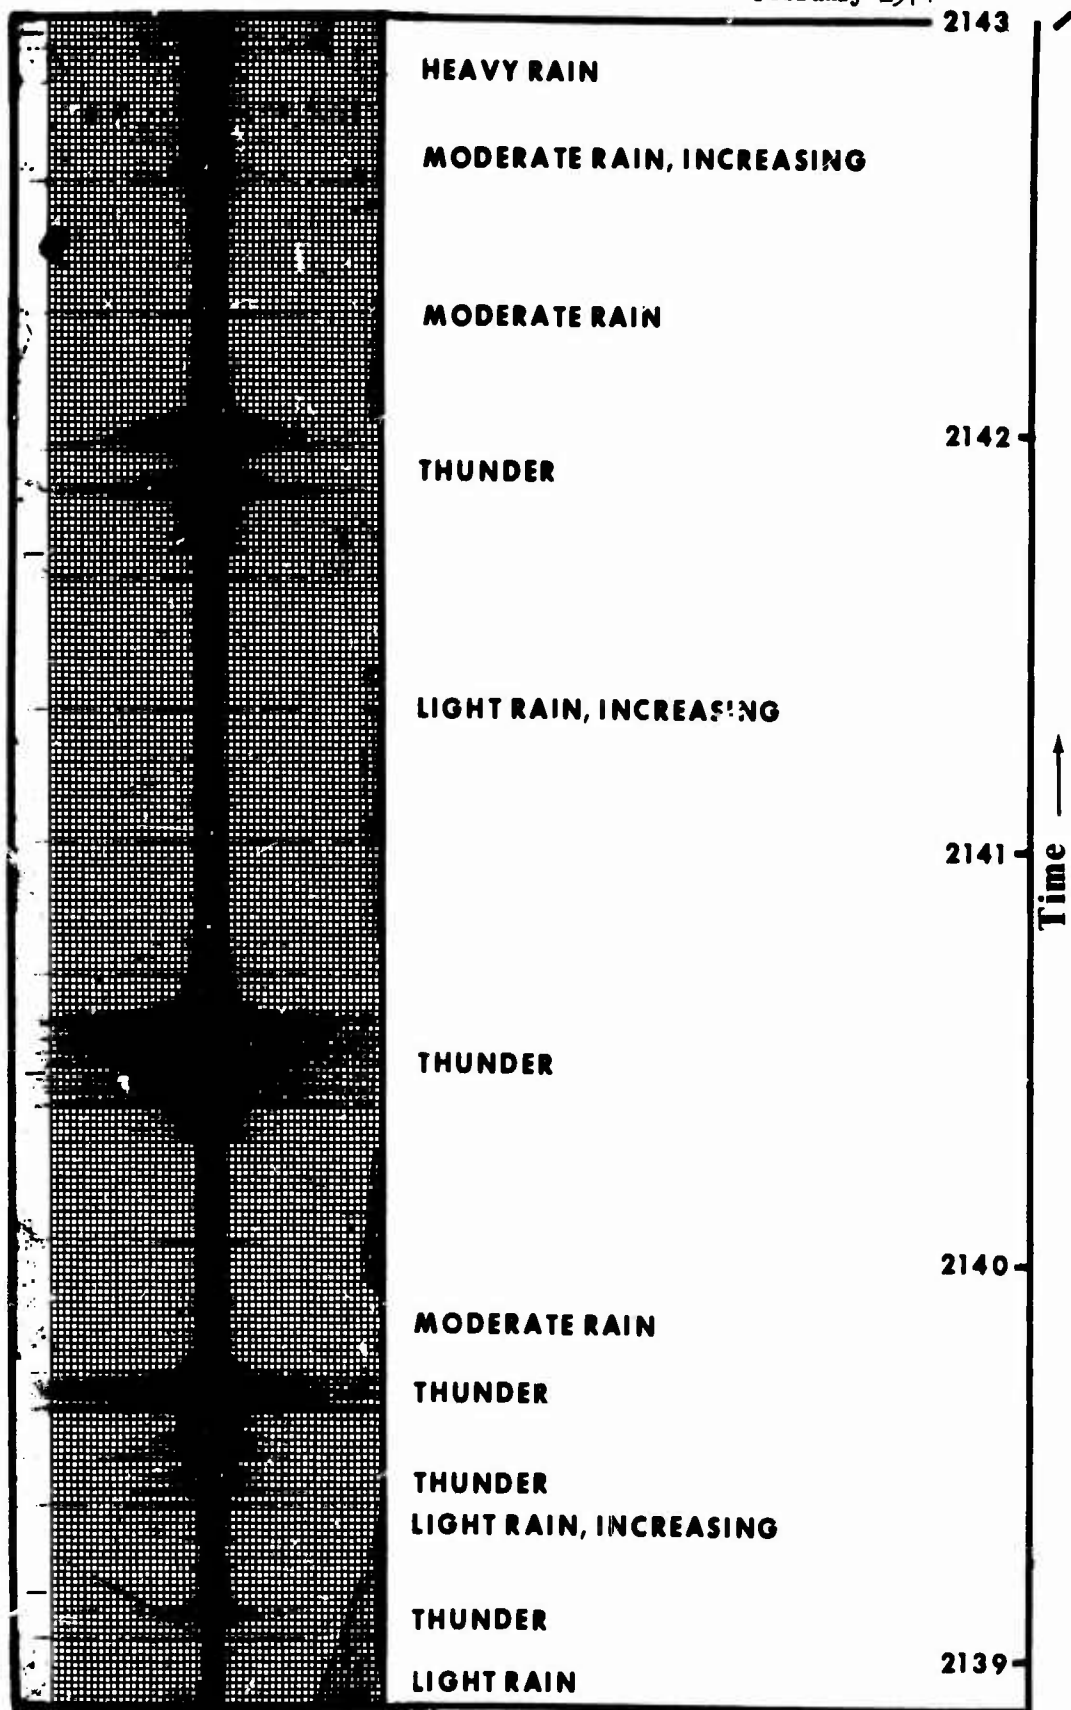


Fig 16. Visual display of portion of acoustic data from 10 Nov 72.

ADSID during the same response period. Selected portions of the acoustic data were recorded on a 1/4 inch magnetic tape at 7½ IPS. The same signal was recorded on two channels.

After 25 November, no acoustic data were collected, because we had sufficient audio data for reproduction purposes and wanted to test the ACOUSIDs in the pure seismic role. No seismic data could be obtained for the ACOUSIDs while they were in continuous audio command. During the earlier parts of the test series, when the ACOUSIDs were commanded once per minute, the seismic count could not be used in analysis because of the 19-second period of each minute when counts were not available. In an operational situation, when weather personnel were monitoring the sensor operation in real time, the audio command would probably be used as a brief check on the seismic returns, without significantly affecting the value of the seismic data.

CONCLUSIONS

1. Seismic activation rates from intrusion sensors can be used to infer rainfall rates with some degree of confidence.
2. Sensors "saturate," that is, activate at a maximum rate when certain rainfall rates are exceeded.
3. There is a lower threshold value of rainfall rates below which sensors do not activate.
4. Gain settings strongly affect the sensor activation rates in rainfall, the lower threshold, and the rainfall rate at which they saturate.
5. Sensors with the same gain setting have different sensitivities to rainfall, especially for lower rainfall rates.
6. Acoustic sensor returns are invaluable aids in interpreting seismic returns.
7. Insufficient data were collected to determine the effects of different types of vegetation on rainfall sensor activations.
8. Seismic sensors are very responsive to thunder, especially nearby thunder. No definite conclusions could be reached on the effect of wind.
9. If seismic sensors are to be used to obtain estimates of intense rainfall, gain settings of 4 and 3 should be used to increase the spectrum of rainfall rates which can be inferred.
10. Because of the data processing capability needed for recovery of rainfall estimates, the use of intrusion sensors to obtain rainfall estimates should be done in conjunction with routine sensor intelligence operations.

RECOMMENDATIONS

1. Although noise levels may obscure the rainfall returns, it would be worthwhile to evaluate sensors with gain settings of 5 and 6 to more accurately estimate lower rainfall rates.
2. If more accurate rainfall comparisons are needed, a controlled experiment with a wider variety of rainfall rates, less variability of rainfall rate occurrences, and accurate rainfall rate and drop size measurements is recommended.
3. Before any operational program of sensor rainfall analysis is begun, the sensors to be used must be evaluated carefully because of variations in sensor types and modifications in design and capabilities.